

OFFICE OF THE MARION COUNTY SURVEYOR

SECTION RECORD CORNER

SECTION 29 TOWNSHIP 17 RANGE 5

DATE: 12-13-99 8-22-06

PARTY CHIEF: Kiste

CREW:

TYPE OF MARKER: Harrison destroyed by sewer



METHOD OF ESTABLISHMENT: County line capped DNR rebar  
3-18-94

IN. S.P.C. E ZONE, NAD 83

NAME: 17052904

N: 515452.4430(m)

E: 71903.3295(m)

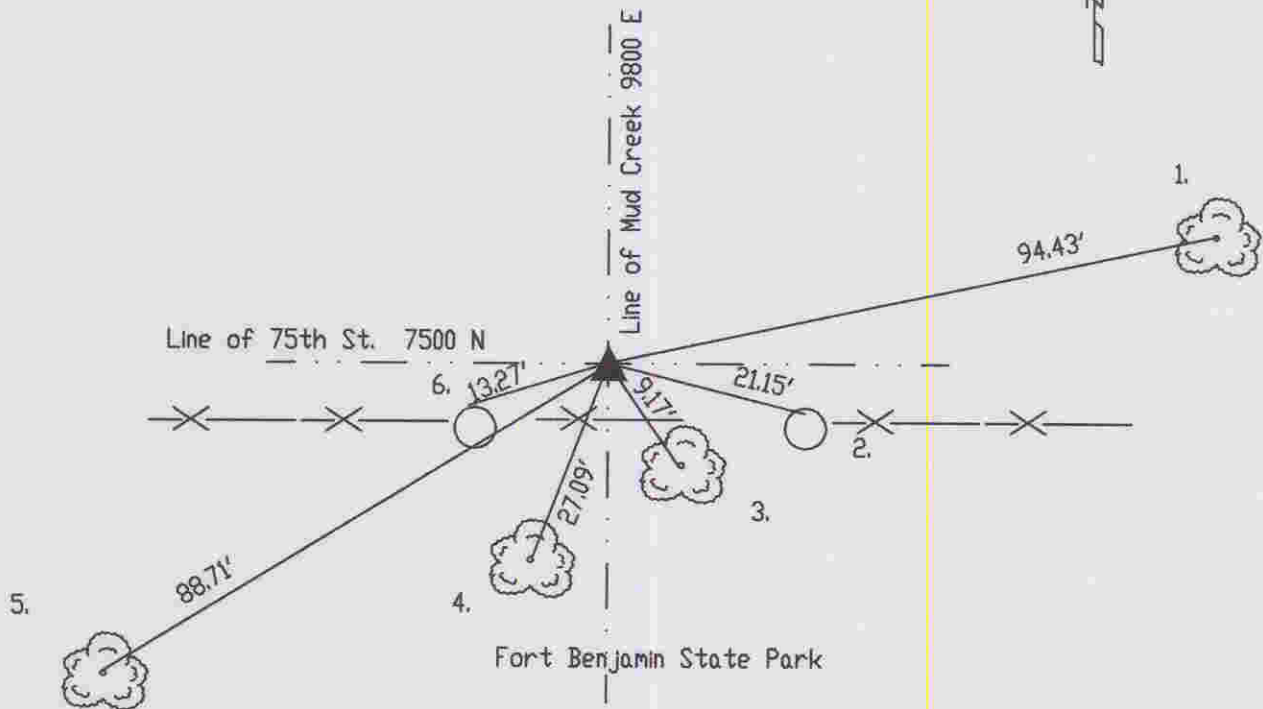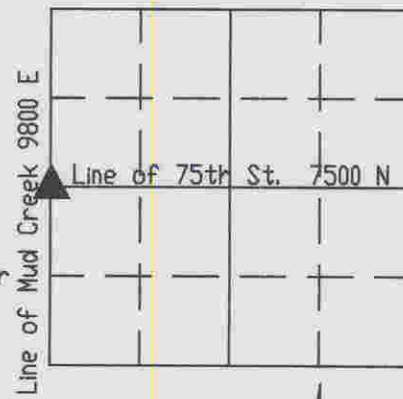

Original post set 1821 by Laughlin with witnesses: 24" beech N 19 W 10 links, and a 12" sugar maple S 26 E 25 links. Legal Survey 10-1866 by Smith per Lawrence Township Legal Survey Book pg. 13 called corner "F" and gives bearing tree. No mention of marker description at corner. Legal 11-1870 by Voorhis & 4-1879 by Fatout (both in Lawrence Township Legal Survey Book pg. 37 showed distances to corner) but no details given. Legal 10-1874 by Voorhis per Lawrence Township Legal Survey Book pg. 13, called corner "L" and called rock found... "set by former surveys..." 9-3-1980 Wilcoxon called 6" square concrete government marker per Cripe Survey Job#79110-00000. Said Cripe job gives bearing and distance to the corners N, E & W. Schneider Eng. Job#426 completed 11-16-81. A boundary survey of Fort Benjamin Harrison also called said monument the corner. Re-tied 3-18-94 by Wilcoxon. Re-tied 12-13-99 by Kiste.

HC752904

REF.	DISTANCE	DESCRIPTION
1.	94.43'	Mag nail w/washer set over railroad spike
2.	21.15'	Mag nail w/washer N wooden fence post
3.	9.17'	Mag nail w/washer set over railroad spike
4.	27.09'	Mag nail w/washer set over railroad spike
5.	88.71'	Railroad spike NW 40" "dead" wild cherry 36"up
6.	13.27'	Mag nail w/washer N wooden fence post 12"up (STATE PARK FENCE)